# **HS-150SRT Premium Accelerometer**

AC acceleration and PT100 temperature output via M12 Connector


# **Key Features**


- PT100 temperature output
- · Side entry for easy access
- · Premium design

#### Industries

Building services, Pulp and Paper, Mining, Metals, Utilities, Automotive, Water, Pharmaceutical



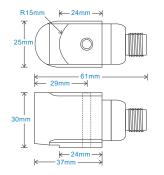



#### **Technical Performance**

Mounted Base Resonance see 'How To Order' table (nominal) Sensitivity see: 'How To Order' table ± 10% Nominal 80Hz at 22°C 1.5Hz (90cpm) to 10kHz (600kcpm) ± 5% Frequency Response 0.5Hz (30cpm) to 12kHz (720kcpm) ± 10% 0.2Hz (12cpm) to 15kHz (900kcpm) ± 3dB Isolation Base isolated see: 'How To Order' table Range Temperature Output PT100 (100 Ohms) Transverse Sensitivity Less than 5%

#### Mechanical

Case Material Stainless Steel
Sensing Element/Construction PZT/Shear
Mounting Torque 8Nm
Mounting Bolt Provided see: 'How To Order' table x 35mm long
Weight 205gms (nominal) body only
Screened Cable Assembly HS-AC010 - straight
HS-AC011 - right angle
Mounting Threads see: 'How To Order' table

### Electrical

 Electrical Noise
 0.1mg max

 Current Range
 0.5mA to 8mA

 Bias Voltage
 10 - 12 Volts DC

 Settling Time
 1 second

 Output Impedance
 200 Ohms max.

 Case Isolation
 >108 Ohms at 500 Volts

### Environmental


 Operating Temperature Range
 -55 to 150°C

 Sealing
 IP67

 Maximum Shock
 5000g

 EMC
 EN61326-1:2013

## Typical Frequency Response (at 100mV/g)




### **Applications**

Fans, Motors, Pumps, Compressors, Centrifuges, Conveyors, Air Handlers, Gearboxes, Rolls, Dryers, Presses, Cooling, VAC, Spindles, Machine Tooling, Process Equipment

Vibration sensor should be firmly fixed to a flat surface (spot face surface may be needed to be produced and cable anchored to sensor body.)



## How To Order

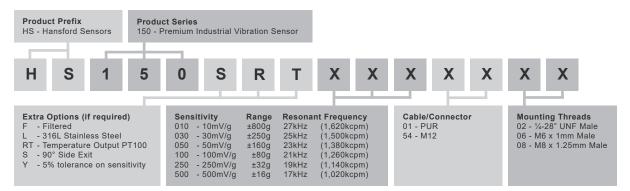



T: 150 210 98804

www.hansfordsensors.com.cn 汉施弗德传感器(上海)有限公司

