# **HS-420ST Accelerometer**

## 4-20mA velocity and temperature output via M12 Connector


#### **Key Features**


- · For use with PLC/DCS systems
- Temperature output

#### Industries

Building services, Pulp and Paper, Mining, Metals, Utilities, Automotive, Water, Pharmaceutical



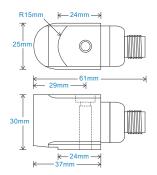

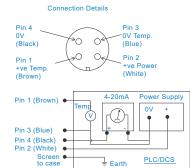

## **Technical Performance**

Mounted Base Resonance 5kHz min Velocity Ranges see: 'How To Order' table ±10% Nominal 80Hz at 22°C Frequency Response 10Hz (600cpm) to 1kHz (60kcpm)  $\pm$  5% - ISO10816 Isolation Base isolated Range 50g peak Temperature Output

10mV/°C - 0-1V proportional to 0-100°C (to convert this to 4-20mA use the HS-540 module)

Transverse Sensitivity Less than 5%

#### Mechanical

Case Material Stainless Steel Sensing Element/Construction PZT/Shear Mounting Torque Mounting Bolt Provided see: 'How To Order' table x 30mm long 185gms (nominal) body only Screened Cable Assembly HS-AC010 - straight HS-AC011 - right angle Mounting Threads see: 'How To Order' table


#### Electrical

**Current Output** 4-20mA DC proportional to Velocity Range Supply Voltage 15-30 Volts DC (for 4-20mA) Settling Time 1 second Output Impedance Loop Resistance 600 Ohms max. at 24 Volts Case Isolation >108 Ohms at 500 Volts

#### Environmental

-25 to 90°C Operating Temperature Range Sealing IP67 5000g Maximum Shock EN61326-1:2013 **EMC** 

## Typical Frequency Response

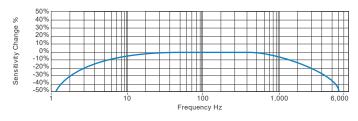


#### **Applications**

Fans, Motors, Pumps, Compressors, Centrifuges, Conveyors, Air Handlers, Gearboxes, Rolls, Dryers, Presses, Cooling, VAC, Spindles, Machine Tooling, Process Equipment

Vibration sensor should be firmly fixed to a flat surface (spot face surface may be needed to be produced and cable anchored to sensor body.)



### How To Order

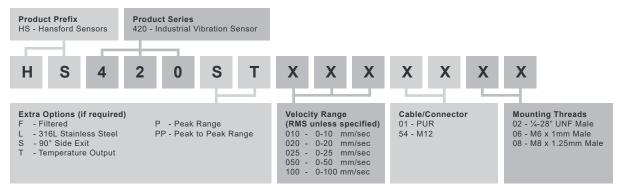



T: 150 210 98804

www.hansfordsensors.com.cn 汉施弗德传感器(上海)有限公司

