HS-100ST Accelerometer

AC acceleration and temperature output via 3 Pin MS Connector


Key Features


- Temperature output
- · Side entry for easy access
- · For use with data collector

Industries

Building services, Pulp and Paper, Mining, Metals, Utilities, Automotive, Water, Pharmaceutical



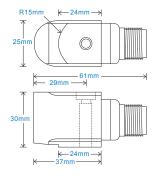



Technical Performance

Mounted Base Resonance see 'How To Order' table (nominal) Sensitivity see: 'How To Order' table ±10% Nominal 80Hz at 22°C 2Hz (120cpm) to 10kHz (600kcpm) ± 5% Frequency Response 1.5Hz (90cpm) to 12kHz (720kcpm) ± 10% 0.8Hz (48cpm) to 15kHz (900kcpm) ± 3dB Isolation Base isolated see: 'How To Order' table Range Temperature Output 10 mV/°C standard 100°C - Option 140°C Transverse Sensitivity Less than 5%

Mechanical

Case Material Stainless Steel
Sensing Element/Construction PZT/Compression
Mounting Torque 8Nm
Mounting Bolt Provided see: 'How To Order' table x 30mm long
Weight 185gms (nominal)
Screened Cable Assembly see: www.hansfordsensors.com for options
Connector HS-AA005 - non-booted
HS-AA068 or HS-0069 - booted
Mounting Threads see: 'How To Order' table

Electrical

 Electrical Noise
 0.1mg max

 Current Range
 0.5mA to 8mA

 Bias Voltage
 10 - 12 Volts DC

 Settling Time
 2 seconds

 Output Impedance
 200 Ohms max.

 Case Isolation
 >108 Ohms at 500 Volts

Environmental


 Operating Temperature Range
 -55 to 140°C

 Sealing
 IP68

 Maximum Shock
 5000g

 EMC
 EN61326-1:2013


Typical Frequency Response (at 100mV/g)




Applications

Fans, Motors, Pumps, Compressors, Centrifuges, Conveyors, Air Handlers, Gearboxes, Rolls, Dryers, Presses, Cooling, VAC, Spindles, Machine Tooling, Process Equipment

Vibration sensor should be firmly fixed to a flat surface (spot face surface may be needed to be produced and cable anchored to sensor body.)



How To Order

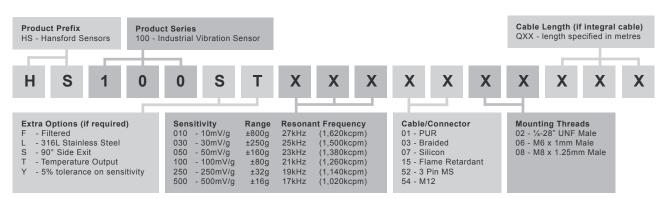



T: 150 210 98804

www.hansfordsensors.com.cn 汉施弗德传感器(上海)有限公司

